



A 12-FL

Stud Welding Gun

93-20-260
93-20-26010



Operating Manual

After-sales service for Germany:

HBS Bolzenschweiss-Systeme GmbH & Co. KG
Felix-Wankel-Strasse 18
85221 Dachau
GERMANY

Phone	+49 8131 511-0
Fax	+49 8131 511-100
E-mail	international@hbs-info.com
Web	www.hbs-info.com

A 12-FL Operating Manual Issue 2024-01 Order No. E-BA 93-20-260

Translation of the Original Operating Manual

Please keep the manual in a safe place for future reference.

Transmission and duplication of this document, dissemination and notification of the contents are not permitted unless expressly approved.

All rights, errors and technical amendments reserved.

© HBS Bolzenschweiss-Systeme GmbH & Co. KG



Dear Customer,

Many thanks for buying a stud welding machine from HBS Bolzenschweiss-Systeme.

We at HBS wish you success at all times when working with this stud welding machine.

The high level of quality of our products is guaranteed by ongoing further development in the design, equipment and accessories. This may result in differences between the present operating manual and your product. No claims can therefore be derived from the data, illustrations and descriptions.

We have compiled the data and information in this reference work with the greatest care, and have made every effort to ensure that the information contained in this manual was correct and up-to-date at the time of delivery. We can nevertheless give no guarantee for an absolutely error-free document.

Should you discover any errors or unclear points when reading this operating manual, please do not hesitate to contact us.

We would also be grateful for any feedback should you have any suggestions or complaints to make about our product.

HBS Bolzenschweiss-Systeme GmbH & Co. KG

Felix-Wankel-Strasse 18

85221 Dachau

GERMANY



Table of Contents

1	Important Safety Precautions	6
2	Symbols and Terms Used	10
3	Scope of Supply	13
4	Accessories	14
5	Technical Data	15
6	Intended Use	16
7	Warranty	17
8	Design and Function	18
9	Welding Process	19
10	Preparing the Stud Welding Gun	20
10.1	Mounting the Chuck	21
10.2	Mounting the Leg assembly	22
10.3	Setting the Welding Parameters	23
	Setting the Insertion Depth (Protrusion)	25
11	Welding	27
12	Troubleshooting	28
13	Maintenance and Care	30
13.1	Cleaning	30
13.2	Inspection and Tests	31



14	Storage	32
15	Disposal	32
	Declaration of Incorporation of partly completed Machinery	33
	Service & Support	34
	Index	35

1 Important Safety Precautions

The target group for this manual are qualified personnel who in view of their technical training, know-how and experience and knowledge of applicable regulations are able to assess the work assigned to them and recognise potential hazards.



Danger from incorrect use

- ◆ Use the stud welding machine only for the purpose described in this manual.

Otherwise you may endanger yourself or damage the stud welding machine.

You endanger yourself and others if you operate the stud welding machine incorrectly or fail to observe the safety precautions and warnings. This can lead to serious injury or extensive material damage.



Danger for unauthorised operating personnel

- ◆ Work with the stud welding machine only when
 - You are appropriately trained, instructed and authorised to do so, and
 - You have read and completely understood this operating manual.
- ◆ Never work with the stud welding machine when you are under the influence of
 - Alcohol,
 - Drugs or
 - Medication.



Danger from unauthorised modifications

- ◆ Never modify the stud welding machine or parts thereof without obtaining a clearance certificate from the manufacturer.

You will otherwise endanger yourself. This can lead to serious injury or extensive material damage.



Life-threatening danger for wearers of active implanted cardiac devices

Danger for workers at particular risk within the meaning of the EMF directive

Persons at particular risk within the meaning of the EMF directive are:

- Workers with active implanted medical devices
 - Workers with passive implanted medical devices that contain metal
 - Workers with medical devices worn on the body
 - Pregnant workers.
- ◆ Never operate the stud welding machine if you are among the group of workers at particular risk within the meaning of the EMF directive.
 - ◆ In this case, never remain in the vicinity of the stud welding machine during welding.
 - ◆ Never operate the stud welding machine if persons are located nearby who are among the group of workers at particular risk within the meaning of the EMF directive.

Strong electromagnetic fields are produced in the vicinity of the stud welding machine during welding. These fields can adversely affect the function of medical devices as well as the course of a pregnancy.



Danger from fumes and airborne particulates

- ◆ Switch on the welding fume extractor at the place of work.
- ◆ Ensure that the room is well ventilated.
- ◆ Never weld in rooms with a ceiling height of less than 3 m.
- ◆ Observe furthermore your working instructions and the accident prevention regulations.

This will help to avoid health damage due to fumes and airborne particulates.



Danger from glowing metal spatter (fire hazard)

Glowing hot weld spatter and liquid splashes, flashes of light and a loud bang > 90 dB (A) must be anticipated during stud welding.

- ◆ Inform colleagues working in the immediate vicinity accordingly before starting work.
- ◆ Ensure that an approved fire extinguisher is available at the work-place.
- ◆ Do not weld when wearing working clothes soiled with flammable substances such as oil, grease, petroleum, etc.
- ◆ Wear your proper protective equipment, such as:
 - Protective gloves in accordance with the relevant standard,
 - Non-flammable clothing,
 - A protective apron over your clothing,
 - Full-ear hearing protection in accordance with the relevant standard,
 - A safety helmet when welding above your head,
 - Safety shoes,
 - Safety goggles with sight glass of protection level 2 in compliance with the applicable standards and do not look directly into the electric arc.
- ◆ Remove all flammable materials and liquids from the vicinity of the work area before starting welding.
- ◆ Weld at a safe distance from flammable materials or liquids. Select a safety distance large enough to ensure that no danger can arise from weld spatter.



Protection of the stud welding unit

- ◆ Protect the stud welding machine against the ingress of foreign matter and liquids caused by cutting or grinding work in the vicinity of your work area.

This will help to prolong the service life of your stud welding machine.

Safety notices in accordance with EMF directive 2013/35/EU

Currents flowing through electrical conductors during stud welding cause electric and magnetic fields that can occur, in particular, near the hand-held welding guns, the welding arrangement (e.g., welding cables) and the welding power sources.

Due to the high currents, high EMF exposures may occur.



Danger for workers at particular risk within the meaning of the EMF directive

Persons at particular risk within the meaning of the EMF directive are:

- Workers with active implanted medical devices
- Workers with passive implanted medical devices that contain metal
- Workers with medical devices worn on the body
- Pregnant workers.

Strong electromagnetic fields are produced in the vicinity of the stud welding machine during welding.

To reduce the danger posed by electromagnetic fields, we recommend, among other things, the following rules of conduct:

- ◆ Lay all cables as close together as possible.

For proper bundling and safeguarding of the cables, HBS offers protective tubes in various sizes.

- ◆ Do not position yourself between the welding cables.
- ◆ Only lay the cables to one side and position them as far as possible from the operating personnel.
- ◆ Do not loop the cables over your body, especially not at head level.
- ◆ Completely unwind the welding cables.
- ◆ Use the shortest possible welding cables.
- ◆ Place portable welding power sources as far away as possible while welding.
- ◆ If possible, do not operate welding power sources in the immediate vicinity of other persons, do not sit directly next to the welding power source while working and do not lean against it.
- ◆ In addition to these safety notices, also observe your work instructions and accident prevention regulations.

2 Symbols and Terms Used

The symbols used in this operating manual have the following meanings:



Danger

Warns you of hazards that can lead to **injury of persons** or to **considerable material damage**.



Caution

Problems in operating **may occur** if this information **is not observed**.



No access for people with active implanted cardiac devices



No access for persons with implants made of metal



No access for pregnant women



Danger

Warns you of **electrical** hazards



Danger

Warns you of **electromagnetic fields** that can be generated during welding



These symbols prompt you to wear **personal protective equipment** when **working with the stud welding unit**.



This symbol prompts you to wear **ear protection**. **A loud bang > 90 dB (A)** can occur during the welding process.



Tip

Cross-reference to **useful information** on the use of the stud welding machine



Cross-references in this operating manual are marked with this symbol or *are printed in italics*



Fire hazard

Have a suitable fire extinguisher for the working area ready before starting work.



Work instruction



List


Glossary

Automatic welding head:	Device for welding of welding elements
Capacitor:	Component for storage of electrical energy.
Electric arc:	Autonomous gas discharge between two electrodes when the current is high enough. A whitish light is emitted in the process. The electric arc allows very high temperatures to be generated.
Rectifier:	Electrical component that converts alternating voltage into direct voltage
Stud feeder:	Device for automatic feeding of welding elements
Stud welding gun:	Device for welding of welding elements
Stud welding system:	Stud welding unit including stud welding gun or welding head
Stud welding unit:	Device for provision of the electrical energy for stud welding
Thyristor:	Electronic component for contact-free switching of high currents; switching takes place via the control input
Welding element:	Component such as stud or pin that is welded to the workpiece
Welding parameters:	Mechanical and electrical settings at the stud welding gun or welding head and at the stud welding unit (e.g. spring force, charging voltage)
Workpiece:	Components such as sheet metal or tubes to which the welding elements are to be fastened

3 Scope of Supply

The **basic configuration** of your stud welding gun contains the following parts:

No. of pieces	Part	Type	Order No.
1	Stud welding gun cable length 5 m	A 12-FL	93-20-260
or			
	Stud welding gun cable length 10 m	A12-FL	93-20-26010
1	Operating manual	A 12-FL	E-BA 93-20-260

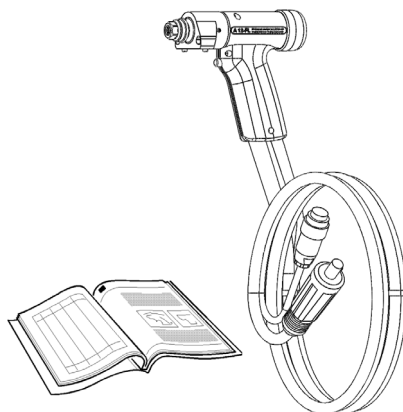


- ◆ Inspect the shipment for visible damage and completeness immediately on receipt.
- ◆ Report any transport damage or missing components immediately to the delivering shipping agent or the dealer (address, see page 2).

4 Accessories

For example:

Mounting tool set 93-40-116

Protective hose, complete with zipper, L = 430 mm 80-11-430

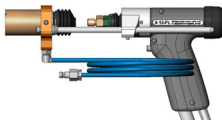Welding range	M6 - M12 / Ø 6 - 12 mm		M2 - M5	
Stud length	10 - 120 mm	10 - 150 mm	40 - 220 mm	75 - 430
	A 12-FL	A 12-FL	A 12-FL	A 12-FL
				
Welding elements				
Welding process	ARC (Shielding gas)	ARC (Ceramic)	ARC (ISO)	
Stud type	ARC threaded studs (FD/MD/DD)/PD/RD), pins (UD/ND), pins with internal thread (ID) SC threaded studs with flange (PS), pins with flange (US), pins with internal thread and flange (IS)	ARC threaded studs (FD/MD/DD)/PD/RD), pins (UD/ND), pins with internal thread (ID)	ARC ISO pins type ND	
Order No.			Order No.	
93-20-260 (Welding gun A 12 with adaptor for ARC chucks)			93-20-26010 (Welding gun A 12-FL without chuck adaptor)	
				
93-40-021 (Shielding gas leg assembly, leg length = 220 mm)	93-40-022 (Ceramic leg assembly, leg length = 220 mm)	93-40-044 (ISO leg assembly with aluminium support tube, leg length = 220 mm)	93-40-066 (ISO leg assembly with support tube and teflon insert, leg length = 220 mm)	
				
			93-40-065 (ISO leg assembly with support tube and teflon insert, leg length = 400 mm)	
93-40-114 (Welding gun accessories ARC gas, M6 to M12)	93-41-012 (Welding gun accessories ARC ceramic, M6 to M12)	ISO chuck for short pins	ISO chuck for long pins	
		Ø 2 mm 80-04-958	80-40-512	
		Ø 3 mm 80-40-959	80-40-452	
		Ø 4 mm 80-40-960	80-05-513	
		Ø 5 mm 80-40-961	80-04-956	

Additional accessories can be found in our extensive accessories catalogue.

5 Technical Data

Stud welding gun type A 12-FL

for ARC stud welding according to current standards

Welding range	M3 to M12, dia. 2 to 12 mm
Stud length	10 to 400 mm (depending on tripod)
Stud material	Mild steel, stainless steel
Stud type	Any type or shape (special chucks if required)
Lift	6 mm fixed
Welding cable	93-20-260: 5 m 93-20-26010: 10 m
IP Code	IP 20 (protect against humidity)
Workplace noise level	Up to 90 dB (A) may occur during welding
Ambient temperature limits	0 °C to 40 °C
Dimension L x W x H	200 x 65 x 140 mm (without cable, with face plate)
Weight	0.8 kg (without cable)



6 Intended Use

The stud welding gun has been designed exclusively for use with standardised stud welding elements. The use of any other elements will result in the desired strength of the welded joint being diminished.

The stud welding gun must only be connected to HBS stud welding units.

- ◆ Always check with the operating manual of your stud welding unit whether this stud welding gun may be used.

Observation of the operating manual of the stud welding unit being used is also part of the intended use.

7 Warranty

Please refer to the latest "General Terms and Conditions" for the scope of the warranty.


The warranty does not cover faults caused by e.g.

- Normal wear,
- Improper handling,
- Failure to observe the operating manual,
- Failure to observe the safety precautions,
- Use for other than the intended purpose, or
- Transport damage.

Warranty entitlement shall no longer be valid if modifications, changes or service and repair work is carried out by unauthorised persons or without the knowledge of the manufacturer. Invalidation of warranty entitlement shall also render the declaration of conformity invalid. The CE marking shall be declared invalid by the manufacturer.

We expressly point out that only spare parts and accessories or components approved by us may be used. The same applies likewise to installed units from our sub-suppliers.

8 Design and Function

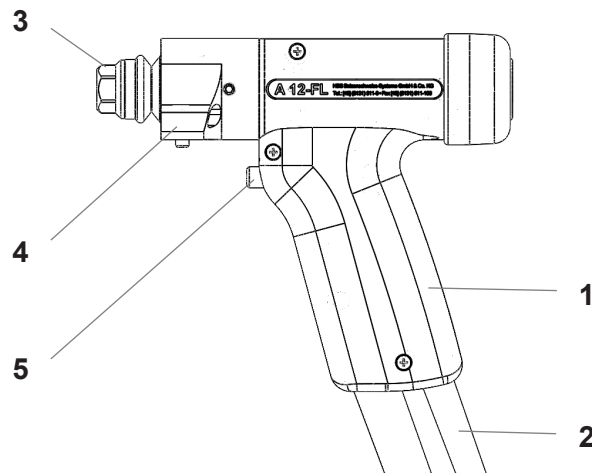

The stud welding gun A 12-FL is equipped with a fixed lift of 6 mm.

The body of the stud welding gun consists of a sturdy two-part **plastic housing (1)**.

The **control cable** and the **welding cable (2)** are connected through the welding gun handle to the welding gun.

Positioned at the front of the stud welding gun are the welding piston and the **retaining nut (3)** used to fix the manual chuck.

At the front of the stud welding gun, the **leg assembly (4)** is installed. Here the leg guidance is mounted.

At the front of the welding gun handle, the **welding gun trigger (5)** is installed. It is used to trigger the welding process.

The serial number is stamped on the welding gun handle.

Type plate

The type plate contains the following information:

- Manufacturer
- Type

9 Welding Process

This stud welding gun may only be used for drawn arc stud welding.

- ◆ Please refer to the original operating manual of the connected stud welding unit for the welding procedure.

10 Preparing the Stud Welding Gun

Prepare the stud welding gun by

 
- mounting the chuck
- mounting the leg assembly
- adjusting the insertion depth (protrusion).




- ◆ Do not connect the stud welding gun to the stud welding unit **until it has been prepared.**

In this way you can avoid any unintentional starting of the welding process.


10.1 Mounting the Chuck




ARC chuck

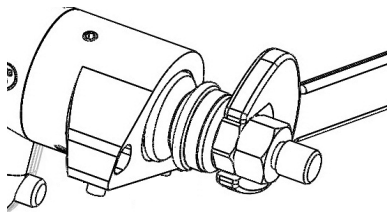

- ◆ Tighten the retaining nut with the 14/17 mm double open-ended wrench.
- ◆ You thereby simultaneously tighten the chuck adaptor.

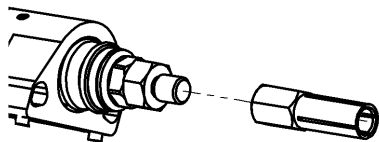

- ◆ Screw the chuck onto the adaptor.

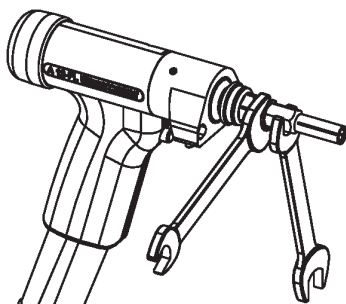

- ◆ Secure the adaptor with a 17 mm double open-ended wrench.
- ◆ Tighten the chuck with a 14 mm double open-ended wrench.




Damage through twisting

- ◆ **Never tighten the chuck if the adaptor is not held with a second double open-ended wrench!**


The interior units or the basic shell could otherwise twist and be damaged.

10.2 Mounting the Leg assembly

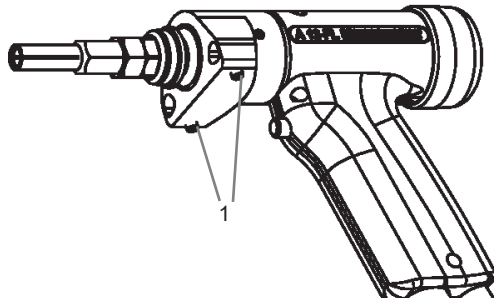


1 - Screws M5 x 8

◆ Loosen the screws (1).

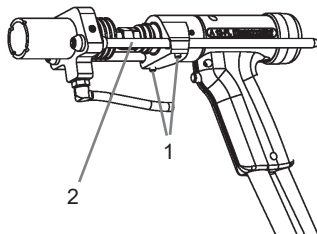

Shielding gas leg assembly

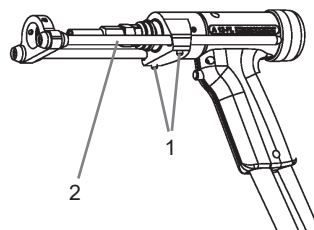


Ceramic leg assembly

2 - Leg

◆ Now attach the leg assembly to the stud welding gun.

◆ Clamp the leg assembly legs (2) with the screws (1).

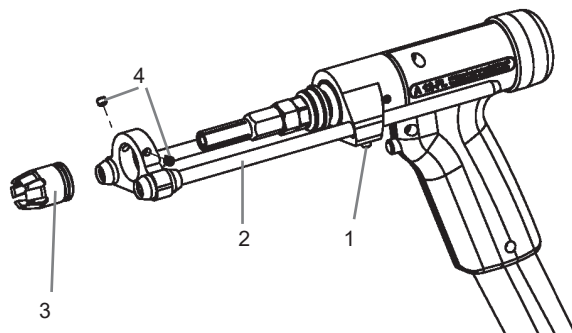

3 - Ceramic ferrule grip

4 - Threaded pin

If you are working with a ceramic leg assembly, then

 
 
 
◆ attach the ceramic ferrule grip (3) to the ceramic leg assembly and clamp it to the foot piece with the threaded pins (4).

10.3 Setting the Welding Parameters

The insertion depth is among others, dependent on the workpiece and welding elements used and their diameters.

The specifications in the following table are guidelines.



◆ Select the applicable parameters for insertion depth for your workpiece.

Welding elements Material: 4.8 (suitable for welding) / A2-50 ⁴⁾	Diameter of welding elements				ARC 800 IT 90, IT 1002, IT 2002, Visar 650, Visar 1200 Stud welding gun parameter A 12-FL ¹⁾ Insertion depth	
	metric		imperial (US)			
	Stud-diameter in mm	eff. diameter in mm	Stud-diameter in inches	eff. diameter in inches		
Material of workpiece: Mild steel (suitable for welding) / alloyed steel (suitable for welding) ⁴⁾						
		Ø d ₁	Ø d ₂	Ø d ₁	Ø d ₂	
	RD (MR) ²⁾	M6	4.7	1/4	0.185	5.0
	RD (MR) ²⁾	M8	6.2	5/16	0.244	5.0
	RD (MR) ²⁾	M10	7.9	3/8	0.311	4.5
	RD (MR) ²⁾	M12	9.5	1/2	0.374	4.0
		Ø d ₁	Ø d ₂	Ø d ₁	Ø d ₂	
	FD/PD/MD (DD) ²⁾	M6	5.35	1/4	0.211	5.0
	FD/PD/MD (DD) ²⁾	M8	7.19	5/16	0.283	5.0
	FD/PD/MD (DD) ²⁾	M10	9.03	3/8	0.356	4.5
	FD/PD/MD (DD) ²⁾	M12	10.86	1/2	0.428	4.0
		Ø d ₁		Ø d ₁		
	UD/ND ²⁾	3 (ISO)		#4 / 12 gage		5.0
	UD/ND ²⁾	4 (ISO)		#8		5.0
	UD/ND ²⁾	5 (ISO)		#10 / 3/16		5.0
	UD ²⁾	6		1/4		5.0
	UD ²⁾	8		5/16		5.0
	UD ²⁾	10		7/16		4.5
	UD ²⁾	12		1/2		4.0

¹⁾ to be checked by test weldings

²⁾ Information and recommendations on this can be found in **DIN EN ISO 14555**.

  ⁴⁾ When welding on galvanized workpieces we recommend decreasing the insertion depth. (In this way the lift increases)

Welding elements Material: 4.8 (suitable for welding) / A2-50 ⁴⁾	Diameter of welding elements				ARC 800 IT 90, IT 1002, IT 2002, Visar 650, Visar 1200	
	metrisch		imperial (US)		Stud welding gun parameter A 12-FL ⁴⁾ Insertion depth	
	Stud-diameter in mm	eff. diameter in mm	Stud-diameter in inches	eff. diameter in inches		
Material of workpiece: Mild steel (suitable for welding) / alloyed steel (suitable for welding) ⁴⁾						
		Ø d ₁	Ø d ₂	Ø d ₁	Ø d ₂	
	ID ²⁾	M6	10	1/4	0.394	5.0
	ID ²⁾	M8	12	5/16	0.472	5.0
		Ø d ₁	Ø d ₂	Ø d ₁	Ø d ₂	
	PS (US, IS) ³⁾	M3	4	1/8	0.157	5.0
	PS (US, IS) ³⁾	M4	5	5/32	0.197	5.0
	PS (US, IS) ³⁾	M5	6	3/16	0.236	5.0
	PS (US, IS) ³⁾	M6	7	1/4	0.276	5.0
	PS (US, IS) ³⁾	M8	9	5/16	0.354	5.0
	PS (US, IS) ³⁾	M10	11	3/8	0.433	4.5

¹⁾ to be checked by test weldings

²⁾ Information and recommendations on this can be found in **DIN EN ISO 14555**.


³⁾ Information and recommendations on this can be found in **DVS 0902**.

⁴⁾ When welding on galvanized workpieces we recommend decreasing the insertion depth. (In this way the lift increases.)




The specified values apply for welding in welding position PA.

Setting the Insertion Depth (Protrusion)

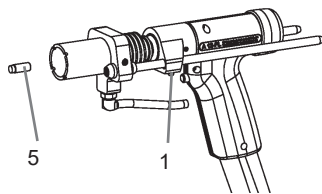


Shielding gas leg assembly

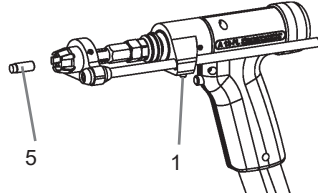

Ceramic leg assembly

- 1 - Screws M5 x 8
- 5 - Welding element


◆ Place a welding element onto the chuck.

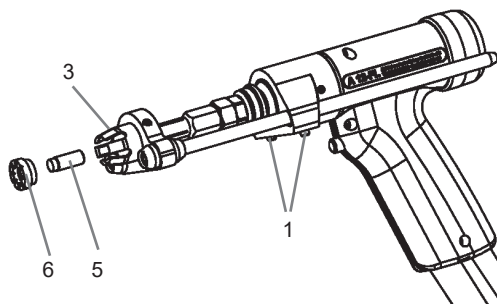


- 3 - Ceramic ferrule grip
- 6 - Ceramic ferrule

If you are working with a ceramic leg assembly, then

◆ place the ceramic ferrule (6) onto the ceramic ferrule grip (3).

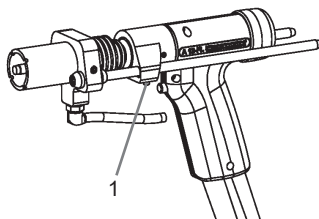


Shielding gas leg assembly

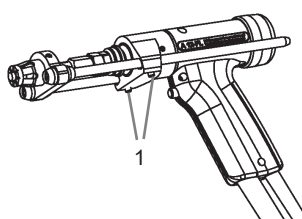

Ceramic leg assembly

- 1 - Screws M5 x 8

◆ Loosen the screws.

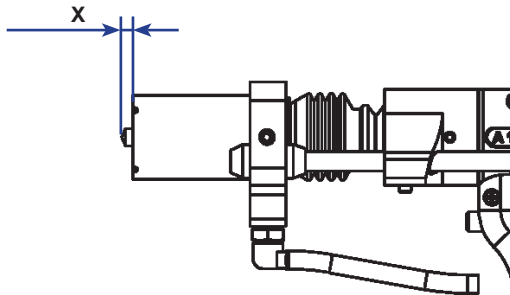

X - Insertion depth (Protrusion)



- ◆ Set the insertion depth (protrusion) (see table in 10.3).
- ◆ To do this, move the leg assembly.

Insertion depth X


The stud welding gun has been developed with a fixed lift of 6 mm.

Welding with shielding gas


Welding with ceramic ferrule

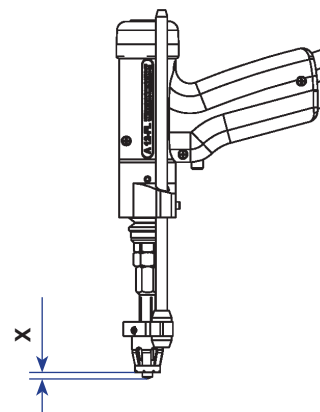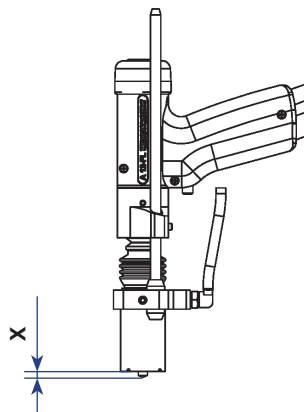

When adjusting a protrusion (insertion depth) of 2 mm, a real lift value of 4 mm results. When adjusting protrusion (insertion depth) of 4 mm, a real lift value of 2 mm results.

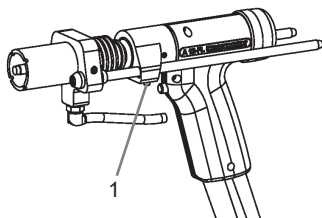

Shielding gas leg assembly

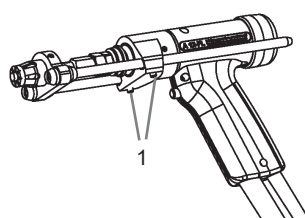

Ceramic leg assembly

1 - Screws M5 x 8

- ◆ Clamp the leg assembly legs with the screws (1).

11 Welding



- ◆ Work according to the *original operating manual of the HBS stud welding unit.*



Danger if used other than for the intended purpose

- ◆ Use the stud welding gun only for ARC stud welding and only in combination with stud welding units from manufacturer:



HBS Bolzenschweiss-Systeme GmbH & Co. KG

Felix-Wankel-Strasse 18
85221 Dachau
GERMANY



- ◆ Always check with the operating manual of your stud welding unit whether this stud welding gun may be used.

12 Troubleshooting



Danger from insufficiently qualified operating personnel

- ◆ Carry out only the work described here on your stud welding unit or stud welding gun.
- ◆ Repairs may only be carried out by appropriately qualified personnel.
- ◆ Inform your dealer or your maintenance department.

Fault	Possible cause	Fault localisation	Fault remedy	Performance
Welding elements not firmly attached	Wrong welding parameters selected Insertion speed of welding element too low	Check adjusted parameters on stud welding unit Check welding piston and linear bearing for ease of movement *)	Change adjusted parameters Clean or replace *)	Trained personnel Qualified specialists
Burning marks at the welding element	Chuck defective Lamellas of chuck are not pretensioned	Check chuck for possible defects Check lamellas of chuck O-rings existing? Check o-rings for possible defects	Replace chuck Try to bend lamellas if possible, otherwise replace chuck Replace o-rings	Trained personnel Trained personnel Trained personnel
Stud welding gun does not weld	Control cable defective (no trigger signal available on stud welding unit)	Check control cable for electrical flow at control cable sleeve (Pin 3 and 4) with pressed welding gun trigger *)	In case of no signal: Replace control cable *)	Qualified specialists
	Micro switch defective (with present contact signal on stud welding unit)	Check micro switch for electrical flow with pressed welding gun trigger *)	In case of no flow: Replace micro switch *)	Qualified specialists
	Welding current cable defective (no contact signal on stud welding unit)	Check, whether welding current cable is connected to stud welding unit in a technically correct way Check welding current cable for electrical flow *)	Connect welding current cable In case of no flow : Replace welding current cable and/or connecting cable *)	Trained personnel Qualified specialists
	Ground connection defective (no contact signal on stud welding unit)	Check, whether ground cable is connected to workpiece in a technically correct way Check ground cable for electrical flow *)	Connect ground cable In case of no flow: Replace ground cable *)	Trained personnel Qualified specialists
	Stud welding unit defective	Follow the instructions of the connected stud welding unit	Repair required	Factory service or authorised agencies

Fault	Possible cause	Fault localisation	Fault remedy	Performance
Stud welding gun does not lift, in spite of  and 	Short circuit of magnetic circuit of the stud welding gun	Measure resistance value at control cable connector (18 Ω to 22 Ω) between Pin 1 and Pin 2 *)	Replace control cable connector, control cable and solenoid *)	Qualified specialists
	Solenoid defective	Measure solenoid (18 Ω to 22 Ω *)	Replace solenoid *)	Qualified specialists
No  display	Magnetic circuit interrupted	Measure resistance value at control cable connector (18 Ω to 22 Ω) between Pin 1 and Pin 2 *)	Replace solenoid or control cable *)	Qualified specialists



Work marked with *) may only be carried out by qualified electricians!

- ◆ Please contact our Service department if none of the measures described remedies the situation.
- ◆ Please use the form „Service & Support“ in the annex to send in the stud welding gun.

13 Maintenance and Care



Electric shock hazard

- ◆ Never perform maintenance and service work on your stud welding gun while it is connected to the stud welding unit
- ◆ Prior to this disconnect the stud welding gun from the stud welding unit.



Danger from insufficiently qualified operating personnel

- ◆ Carry out only the work described here on your stud welding gun.
- ◆ Repairs may only be carried out by appropriately qualified personnel.
- ◆ Inform your dealer or your maintenance department.

13.1 Cleaning

- ◆ Clean the casing of your stud welding gun with a slightly damp washcloth, when necessary.



- ◆ **Do not use solvents for cleaning.**
These may damage plastic components.

13.2 Inspection and Tests

- ◆ Inspect the chuck before every use.
- ◆ Replace the chuck if you discover burning marks on the welding element and/or on the chuck.
- ◆ Work here in accordance with *point 10.1 „Mounting the chuck“* in this manual.
- ◆ Before every use, inspect the bellows on the front part of the stud welding gun for proper seating and/or damage.



- ◆ **Never work with damaged or incorrectly seated bellows.**

This will contribute to a long service life of your stud welding gun.

- ◆ Inform your dealer or maintenance department if you discover any damage.
- ◆ Before every use, check that the type designations and adjustment aids on the stud welding gun are still legible.
- ◆ Clean the type plates in the event of soiling.
- ◆ Replace any type plates that are damaged or no longer legible.

14 Storage

- ◆ Store the stud welding gun in a safe and dust-free location when not in use.
- ◆ Protect the stud welding gun from moisture and metallic contamination.



- ◆ Store the stud welding gun only under the following ambient conditions.

Storage temperature:


-5 °C to +50 °C (23 °F to 122 °F)

Relative humidity:

0 % - 50 % at +40 °C (104 °F)

0 % - 90 % at +20 °C (68 °F)

15 Disposal

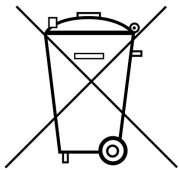

- ◆ Dispose of the stud welding gun only via the manufacturer or a specialist disposal company.
- ◆ Never dispose of the stud welding gun in the domestic refuse.



Declaration of Incorporation of partly completed Machinery

to Directive 2006/42/EC, Annex II 1 B

(Original Declaration of Incorporation)

Herewith the manufacturer

HBS Bolzenschweiss-Systeme GmbH & Co. KG
Felix-Wankel-Strasse 18
P.O. Box 13 46
85221 Dachau
GERMANY
Phone +49 8131 511-0
Fax +49 8131 511-100

declares for the following product

Machine information: Stud welding gun

Type: A 12-FL

Order No: 93-20-260 or 93-20-26010

Serial No: 93-20-260/242XXXX or 93-20-26010/242XXXX

Year of manufacture: 2024

that the following essential requirements of the above mentioned Directive – including changes to the Directive to be applied at the moment of this declaration – were applied and fulfilled:

Annex I, Article 1, 1.1.2, 1.1.3, 1.1.5, 1.1.6, 1.1.7, 1.2.1, 1.2.2, 1.2.3, 1.2.4.1, 1.2.6, 1.3.1, 1.3.2, 1.3.3, 1.3.4, 1.3.7, 1.3.8, 1.3.9, 1.4.1, 1.4.2.1, 1.5.1, 1.5.2, 1.5.4, 1.5.5, 1.5.6, 1.5.8, 1.5.10, 1.5.11, 1.5.15, 1.5.16, 1.6.1, 1.6.2, 1.6.3, 1.6.4, 1.7.1.1, 1.7.2, 1.7.3, 1.7.4,

that special technical documentation was compiled in accordance with Part B of Annex VII of the above mentioned regulation and will be transmitted, in response to a reasoned request by the national authorities as follows:

The above mentioned documents will be transmitted by e-mail as a data file in German language.

that this partly completed machinery must not be put into service until the final machinery into which it is to be incorporated has been declared in conformity with the provisions of the Directive, where appropriate.

that this incomplete machine complies with corresponding regulations of the following additional EU Directives, including any changes to be applied at the moment of this declaration:

„Electromagnetic compatibility“ 2014/30/EU

Protection targets of the low voltage regulation were kept to appendix I, no. 1.5.1 of the machine regulation.

Persons who are based in the European community and who are authorised to compile the technical documentation:

Name: Address: see manufacturer

Dachau, 02.01.2024

Place of issue, Date

Anja Bloch (CEO HBS)



Service & Support

With the return please attach a copy of the filled out form together with the repair number given by HBS! Repairs without repair number will not be processed.

Repair number

(given by HBS)

Company:

Name / Surname:

Street:

City, State and ZIP/Postcode:

Country:

Phone & Fax:

E-mail address:

Stud welding unit / stud welding gun
type of model:

Serial number:

Date of purchase:

Purchased at distributor:

Detailed descriptions of errors:

Service & Support may be done up to the value of EUR _____
without quotation:

☐ Yes

☐ No

Could you find any damage / burn marks

on the cables:

☐ Yes

☐ No

on chucks:

☐ Yes

☐ No

Are all plug and screw connections tightly fastened *:

☐ Yes

☐ No

Are there any burn marks on plug or screw connections:

☐ Yes

☐ No

Is there any other visual damage (e.g. cracks, dents):

☐ Yes

☐ No

Have you checked the fuses:

☐ Yes

☐ No

Default on the display of the stud welding unit:

ARC / IT					CD / CDM / SC					

Which LED's are illuminated (please mark with a cross)?

Please e-mail or fax this form to service@hbs-info.de or fax: +49 8131 511-100.
In case a repair is necessary a repair number will be given!

* See also operating manual chapter „Connection“

** Doesn't light when using a contact welding gun

Index

A

accessories	14
airborne particulates	7
automatic welding head	12

B

bang	8
basic configuration	13

C

capacitor	12
chuck, mounting	21
cleaning	30
clothing, non-flammable	8
control cable	18

D

danger from incorrect use	6
Declaration of Incorporation	33
disposal	32

E

ear protection	10
electrical hazards	10
electric arc	12
electromagnetic fields	10
EMF directive, safety notices	9

F

fire extinguisher	8
fire hazard	8
form „Service & Support“	29, 34
full-ear hearing protection	8
fumes, harmful to health	7

G

glossary	12
goggles with visor	8

H

hazards for the machine	10
hazards for the operator	10
heart pacemaker	7, 10
helmet	8

I

insertion depth	23
intended use	16, 27

L

leg assembly	18
------------------------	----

M

maintenance and care	30
--------------------------------	----

O

operating manual	13
----------------------------	----

P

protective apron	8
protective equipment	8
protective equipment, personal	10
protective gloves	8

R

rectifier	12
retaining nut	18

S

safety goggles	10
safety goggles with sight glass	8
safety precautions	6
scope of supply	13
serial number	18
setting the insertion depth	25
storage	32
storage temperature	32
stud feeder	12
stud welding gun	12
stud welding system	12
stud welding unit	12
symbols used	10

T

troubleshooting	28
type plate	18

W

warranty entitlement	17
welding cable	18
welding element	12, 16
welding gun, design	18
welding gun trigger	18
welding parameters	12, 23
workpiece	12

HBS Bolzenschweiss-Systeme GmbH & Co. KG
Felix-Wankel-Strasse 18 • 85221 DACHAU • GERMANY
Phone +49 8131 511-0 • Fax +49 8131 511-100 • E-mail international@hbs-info.com

www.hbs-info.com